
**C3396a - LLEWELLYN MOTORS SPRINGFIELD - LOT 34****C3396a-0004(4).xls****DISTRIBUTION BOARD DB-A (LOWER GROUND)****REVISION 4 - 05 FEBRUARY 2026**

FAULT CURRENT:	6KA USING CASCADING	MAIN SWITCH:	250A NON AUTO LOAD BREAK	REV
CHASSIS SIZE:	2 X 96 POLE	SUPPLIED FROM:	MSB	A
CHASSIS RATING:	250A	SUPPLY CABLE:	4C70	A
PHASES:	3			A

PROVIDE THE DB WITH A FULL WIDTH EMPTY DIN RAIL TO ACCOMMODATE FUTURE CONTACTORS AND CONTROLS. PROVIDE THE DB WITH AN AS2293 EMERGENCY LIGHTING CONTROL SYSTEM TO CONTROL THE ASSOCIATED EMERGENCY LIGHTS. PROVIDE THE DB WITH SURGE PROTECTION. EACH CUBICAL MUST BE 800 WIDE. REFER TO THE NOTES FOR ADDITIONAL REQUIREMENTS

CIRC	PH	CIRCUIT BREAKER (amps)	CONTROL EQUIPMENT	CABLE SIZE (mm ²)	LOCATION	CIRCUIT USE	
P1	3	40	RCD TYPE B	6.0	LEVEL 1	LIFT	B
P2	3	40	MCB	6.0	OIL STORE	COMPRESSOR	2
P3	3	20	RCBO	2.5	AMENITY	HWS	B
P4	3	20	RCBO	2.5	WORKSHOP	RSD	B
P5	3	20	RCBO	2.5	DELIVERY	RSD	B
P6	3	20	RCBO	2.5	EXTERNAL	WASH BAY	B
P7	3	20	RCBO	2.5	WORKSHOP	HOIST	B
P8	3	20	RCBO	2.5	WORKSHOP	HOIST	B
P9	3	20	RCBO	2.5	WORKSHOP	HOIST	B
P10	3	20	RCBO	2.5	WORKSHOP	HOIST	B
P11	1	20	RCBO	2.5	EXTERNAL	PUMP	B
P12	1	20	RCBO	2.5	EXTERNAL	PUMP	B
P13	1	20	RCBO	2.5	EXTERNAL	PUMP	B
P14	1	20	RCBO	2.5	EXTERNAL	GPO	B
P15	1	20	RCBO	2.5	EXTERNAL	IRRIGATION	B
P16	1	20	RCBO	2.5	WORKSHOP	GPO	B
P17	1	20	RCBO	2.5	WORKSHOP	GPO	B
P18	1	20	RCBO	2.5	WORKSHOP	GPO	B
P19	1	20	RCBO	2.5	WORKSHOP	GPO	B
P20	1	20	RCBO	2.5	WORKSHOP	GPO	B
P21	1	20	RCBO	2.5	WORKSHOP	GPO	B
P22	1	20	RCBO	2.5	WORKSHOP	GPO	B
P23	1	20	RCBO	2.5	SUPERVISORS DESK	GPO	B
P24	1	20	RCBO	2.5	CIRCULATION	GPO	B
P25	1	20	RCBO	2.5	AMENITY	HD	B
P26	1	20	RCBO	2.5	RECEPTION	AUTO DOOR	B
P27	1	20	RCBO	2.5	CIRCULATION	GPO	B
P28	1	20	RCBO + SHUNT TRIP	2.5	DELIVERY	7KW CHARGER	2
P29	1	20	RCBO	2.5	RECEPTION	DESK	B
P30	1	20	RCBO	2.5	DELIVERY	GPO	B
P31	1	20	RCBO	2.5	ADMIN	GPO	B
P32	1	20	RCBO	2.5	ADMIN	GPO	B
P33	1	20	RCBO	2.5	LOUNGE	GPO	B
P34	1	20	RCBO	2.5	PARTS	GPO	B
P35	1	20	RCBO	2.5	SPECIAL TOOLS	GPO	B
P36	1	20	RCBO	2.5	SPECIAL TOOLS	GPO	B
P37	1	20	RCBO	2.5	SPECIAL TOOLS	GPO	B
P38	1	20	RCBO	2.5	WORKSHOP	WHEEL BALANCER	4
P39	1	20	RCBO	2.5	PARTS	HWS	B
P40	1	20	RCBO	2.5	UNIT REPAIR	GPO	B
P41	1	20	RCBO	2.5	LUNCH ROOM	GPO	B
P42	1	20	RCBO	2.5	AMENITY	GPO	B
P43	1	20	RCBO	2.5	WORKSHOP	WHEEL BALANCER	B
P44	1	20	RCBO	2.5	WORKSHOP	TYER CHANGER	B
P45	1	20	RCBO	2.5	WORKSHOP	GPO	B
P46	1	20	RCBO	2.5	WORKSHOP	GPO	B
P47	1	20	RCBO	2.5	WORKSHOP	WHEEL ALIGNMENT	B

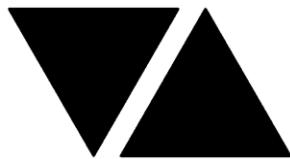

ELECTRICAL DESIGN GROUP

ELECTRICAL BUILDING SERVICES CONSULTANTS

P.O. Box 15, SHERWOOD Q. 4075

Phone: (07) 3278 4375

Website: www.edq.net.au Email: brisbane@edq.net.au

C3396a - LLEWELLYN MOTORS SPRINGFIELD - LOT 34


C3396a-0004(4).xls

DISTRIBUTION BOARD DB-A (LOWER GROUND)

REVISION 4 - 05 FEBRUARY 2026

REV	
FAULT CURRENT:	6KA USING CASCADING
MAIN SWITCH:	250A NON AUTO LOAD BREAK
CHASSIS SIZE:	2 X 96 POLE
SUPPLIED FROM:	MSB
CHASSIS RATING:	250A
SUPPLY CABLE:	4C70
PHASES:	3

PROVIDE THE DB WITH A FULL WIDTH EMPTY DIN RAIL TO ACCOMMODATE FUTURE CONTACTORS AND CONTROLS. PROVIDE THE DB WITH AN AS2293 EMERGENCY LIGHTING CONTROL SYSTEM TO CONTROL THE ASSOCIATED EMERGENCY LIGHTS. PROVIDE THE DB WITH SURGE PROTECTION. EACH CUBICAL MUST BE 800 WIDE. REFER TO THE NOTES FOR ADDITIONAL REQUIREMENTS

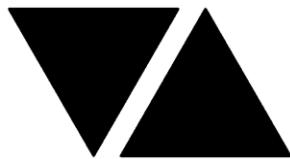

ELECTRICAL DESIGN GROUP

ELECTRICAL BUILDING SERVICES CONSULTANTS

P.O. Box 15, SHERWOOD Q. 4075

Phone: (07) 3278 4375

Website: www.edg.net.au Email: brisbane@edg.net.au

C3396a - LLEWELLYN MOTORS SPRINGFIELD - LOT 34

C3396a-0004(4).xls

DISTRIBUTION BOARD DB-A (LOWER GROUND)

REVISION 4 - 05 FEBRUARY 2026

REV	
FAULT CURRENT:	6KA USING CASCADING
MAIN SWITCH:	250A NON AUTO LOAD BREAK
CHASSIS SIZE:	2 X 96 POLE
SUPPLIED FROM:	MSB
CHASSIS RATING:	250A
SUPPLY CABLE:	4C70
PHASES:	3

PROVIDE THE DB WITH A FULL WIDTH EMPTY DIN RAIL TO ACCOMMODATE FUTURE CONTACTORS AND CONTROLS. PROVIDE THE DB WITH AN AS2293 EMERGENCY LIGHTING CONTROL SYSTEM TO CONTROL THE ASSOCIATED EMERGENCY LIGHTS. PROVIDE THE DB WITH SURGE PROTECTION. EACH CUBICAL MUST BE 800 WIDE. REFER TO THE NOTES FOR ADDITIONAL REQUIREMENTS